



# LBO233 STANDARD • 5YR LED PLL LAMP

**DIRECT WIRE LED LAMP** 


#### **FEATURES**

- Direct wire no ballast required
- Replaces 40W CFL PLL Lamps
- Simple installation

#### **APPLICATION**

This LED lamp is an efficient way to light sockets once traditionally reserved for compact fluorescents.

#### **LIGHT DISTRIBUTION CURVE**

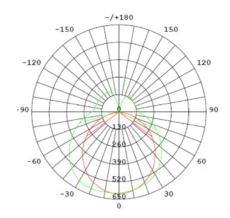

Wattage	23W	
Voltage	120-277V	
Current	209mA	
Power Factor	0.9	
Total Harmonic Distortion (THD)	N/A	
LIGHTING PERFORMANCE		
Lumens	2600	
Lumens Per Watt (Lm/W)	113	
Color Temperature (CCT)	3500K	
Color Rendering (CRI)	82	
R9 (Red Value)	N/A	
R13 (Skin Tones)	N/A	
Beam Angle	115°	
Light Distribution	Type III, Very Short	
Dimmable Lighting Control	Ver consents.	
ENVIRONMENT		
Operating Temperature	-4 ~ 113°F	
Suitable Location	DAMP	
Ingress Protection Rating	IP20	
Suitable Fixture Type	Onon	
LIFESPAN		
Average Life (Hours)	ours) 50,000	
Warranty (Years)	5	
COMPONENTS		
LED Light Source	Everlight	
CONSTRUCTION		



Base / Power Supply

QUALIFICATIONS

Manufacturer Model #

Housing

Lens

**ELECTRICAL** 

Manufactured by P.Q.L., Inc. - Published lumens on LED products are approximate and may vary slightly.

Glass / PC

Frost

2G11 / Plug In

91270

## LBO233 STANDARD • 5YR LED PLL LAMP



NI	M	N	ÇI	N	PI	(Inc	hes)

Zimiziterette (menee)	
Length	22.5"
Width/Diameter	0.7"
Height	1.6"
Weight (Lbs)	

	Tube diameter: 0.7"	
		1.6"
	22.2"	
-	22.5" —	

Line drawings may not be to scale and are for general reference only.

PACKAGING		UPC	<b>DIMENSIONS</b> (LxWxH)	<b>GROSS WEIGHT</b> (Lbs)
Master Carton	10811768027638	50		<del></del>
Individual Box	811768027631	1		<del></del>
Country of Origin	China			
HS Tariff	9405.40.8200			

### **ORDERING**

ITEM#	DESCRIPTION	CASE
LB0233	LED PLL 23WT5/115°/FR/35K//2G11/120-277V	50

Manufactured by P.Q.L., Inc. - Manufacturer Model # 91270

#### **ADDITIONAL INFORMATION:**

\*It was originally thought this lamp was suitable for totally enclosed fixtures. After live aging and further evaluation, it has been determined excessive heat may cause the lamp not to function properly. Therefore it is not recommended to be used in totally enclosed fixtures.